Micro-ohmmeter





- Up to 220 A
- Battery supplied
- Lightweight 1 kg
- Safe test DualGround™
- Auto range: 1 $\mu\Omega$ to 1000 mΩ
- Bluetooth® PC communication
- Complies with IEEE and IEC standards

DESCRIPTION

The MOM2 is designed to measure the resistance of circuit breaker contacts, bus-bar joints and other high-current links. This product is designed with safety, ease of use and versatility in mind.

The micro-ohmmeter can be used anywhere to measure a low resistance value with high accuracy.

MOM2 uses an ultra capacitor to generate the high output current. The ultra capacitor is able to store a huge amount of energy compared to conventional capacitors and can deliver very high current during the discharge thanks to its very low internal resistance.

While testing, the capacitor is discharged through the test object and the voltage drop across- and the current flow through the test object are continuously and synchronously sampled. The resistances calculated from the individual samples are then averaged to obtain the final value.

With MOM2 it is possible to make measurements according to the DualGround™ method. This means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow.

The ruggedness and lightweight makes MOM2 a handheld instrument very suitable for field work, such as in substations. The unit comes with a strong rubber holster accessory which makes it extra durable. MOM2 is dimensioned to make a full day's work of testing without recharge. It can store 104 test values and transfer test data to a PC via Bluetooth.

APPLICATIONS

MOM2 test system is designed to serve a number of applications. The most common are contact resistance measurements of low-, medium- and high-voltage breakers and also at bus-bar joints, and other high current links.

If the contact resistance is too high this will lead to power loss and temperature rise, which often leads to serious trouble. To avoid such problems, it is necessary to check the resistance at regular intervals.

The following table demonstrates how important low resistance is at high currents:

Current	Contact resistance	Power loss
10 kA	1 mΩ	100 kW
10 kA	0.1 mΩ	10 kW
1 kA	1 mΩ	1 kW
1 kA	0.1 mΩ	100 W

At 10 kA a contact with the resistance 0.1 m Ω gives a power loss of 10 kW. This power loss in one single point will definitely confer a temperature rise, which may result in overheating and possibly premature failure.

Micro-ohmmeter

Megger.

FEATURES AND BENEFITS

- **1.** Current output terminal (-)
- 2. Current output terminal (+)
- 3. Display

The display offers a combination of analogue arc and a dual digital readout:

- Analogue arc:
- Indicates level of the capacitor charge.
- Dual digital display:
- Large main digital readout for good visibility of all main measurement results Second digital display for additional data.
- 4. Ground (earth) terminal
- 5. Keys for navigation and to make settings in the display
- 6. TEST-button
- **7.** Stand-by/Wake up (Press shortly to toggle) Clear log (Press and hold for 5 seconds)

8. Function selector

OFF				
I Selection 1	0.1 s	Measurement time with minimum current guarantee		
I > I min	0.6 s			
	3 s			
	0.1 s	Measurement time with max. charge		
I = I max	0.6 s			
	3 s			
	*	Bluetooth "pair units"		
	CLK	Set date and time		
		Set volume for the internal loudspeaker		
SET		Discharge the MOM2 internal capacitor		
	I min	Minimum current guarantee setting		
	LOG	Data log settings		
	P/F	Pass/Fail settings		
PC COM		PC communication (dump data to PC)		
USER	1 2 3	Stored settings. Set from PC, MOM2 Win		

- 9. Connector for the voltage (–) sense lead
- 10. Connector for the voltage (+) sense lead and the trig function
- **11.** Connector for the battery charger
- 12. Battery charger indicator



Micro-ohmmeter

Megger.

APPLICATION EXAMPLES

Circuit Breaker testing

- Test of circuit breaker contacts
- Test of the connections to the breaker

Testing of Bus-bar


- Test of Bus-bar joints
- Test of connections

Everywhere you need to test a low resistance/ high current connection

- Switches
- Disconnecting devices
- Safety ground connections
- Welding points
- Fuses
- Cables



Hold probes / attach Kelvin clamps to CB and press trig / TEST button. A signal indicates whether test was pass or fail and result is logged in unit for later dump to PC.

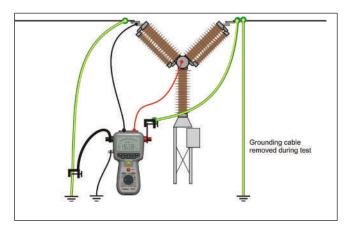

Traditional measurement from ground. Injection is done through existing grounding cable (earthing). Use any of the optional cable kits, GA-00380/82/84, with 5, 10 or 15 m cables.


BOTH SIDES GROUNDED

Many utilities require safety grounds to remain in place during station outages, therefore, the MOM2 was designed with this field safety constraint in mind. DualGround means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow. Minimum time shall be spent in the substation and focus shall be on the test rather than the equipment.

Conventional vs. DualGround				
Site preparation (isolate work area, apply safety ground, issue permit to work)	Site preparation (isolate work area, apply safety ground, issue permit to work)			
Hook up test equipment. Issue sanction for test	Hook up test equipment. Issue sanction for test			
Authorised person removes the ground	Risky step left out			
Perform testing	Safe testing with both sides grounded			
Authorised person applies ground	Risky step left out			
Cancel sanction for test. Disconnect test equipment	Cancel sanction for test. Disconnect test equipment			
Site closing (cancel permit to work, disconnect ground)	Site closing (cancel permit to work, disconnect ground)			



Equipment and methods that supports DualGround™ testing are associated with the DualGround symbol. This symbol certifies the use of groundbreaking technology and methods that enables a safe, fast and easy workflow with both sides grounded throughout the test.

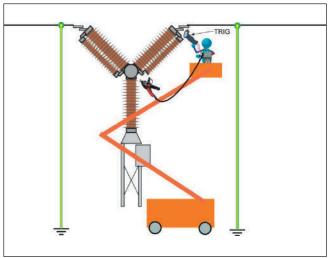


Measurement on CB with both sides grounded, DualGround. Here is a combination of one clamp and one probe used.

Megger.

MOM2 Micro-ohmmeter

4 WIRE KELVIN TEST

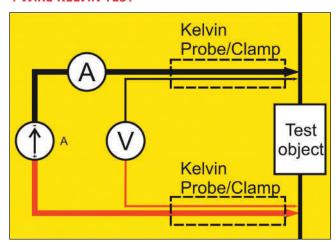

The Kelvin probes (incl. in BD-59090) are used for a 4 wire Kelvin test. This is a way of measuring continuity resistances ensuring all contact and lead resistances are compensated for, which allows a much greater accuracy in measurements. Each Kelvin probe assembly has two probe tips. One tip is for the current generated and the other will measure the very small voltage present.

The Kelvin clamps (incl. in BD-59092) uses the same principle.



Carrying strap that facilitates work when measuring with two probes. Included with instrument.



MOM2 (BD-59092) with Transport case, Charger, Kelvin clamps, Rubber holster, Carrying strap, Belt clip, MOM2 Win.

Micro-ohmmeter

Megger

SPECIFICATIONS

Specifications are valid at fully charged batteries and an ambient temperature of +25°C, (77°F). Specifications are subject to change without notice

Environment

Application field For use in high-voltage substations

and industrial environments.

Temperature

-20°C to +50°C (-4°F to +122°F) *) Operation -40°C to +70°C (-40°F to +158°F) Storage Relative humidity %RH 5%-95%, non condensing

*) Battery operation temperature 0°C to +50° (32°F to +122°F) Battery charging temperature +10°C to +40° (50°F to +104°F)

CE-marking

2014/30/EU **EMC** LVD 2014/35/EU **RoHS** 2011/65/EU

Classifications and standards

Pollution degree

Shock IEC 60068-2-27 **Vibration** IEC 60068-2-6 Transport ISTA 2A Flammability class V0

General

Battery power Five AA (HR6) 2700 mAh NiMH cells

Recharge time < 12 h Typical recharge time 3 h

at 25°C

Battery charger

Mains voltage 100-250 V AC, 50 / 60 Hz

Power consumption 24 W

Protection Against wrong battery type, low/high

> temperature. ≥10 years

Different buzzer sounds

Real time clock battery

Audible feedback

life

User presets 3 Field calibration Yes Encapsulation IP54

Dimensions

Instrument (excl. 217 x 104 x 72 mm 8.5 x 4.1 x 2.8 in. binding posts) 395 x 300 x 190 mm Carrying case 15.6 x 11.8 x 7.5 in.

1.0 kg (2.2 lbs) instrument only Weight

5.0 kg (11 lbs) with accessories and

carrying case

Measurement section

Minimum current guar-Selectable 50 A / 100 A antee Valid at resistance ≤2mΩ Pass / Fail Settable from 1 $\mu\Omega$ to 1999 $m\Omega$ Number of measuretyp. 2200 at I min = 50 A and 0.1 s ments on fully charged typ. 800 at I min = 100 A and 0.1 s

batteries

Interference suppres-

sion

0 - 1000 mO Range

Range selection Auto

Resolution

 $0 - 999 \mu\Omega$ 1 μΩ $1.0 - 9.99 \text{ m}\Omega$ $0.01~\text{m}\Omega$ $0.1 \, \text{m}\Omega$ $10.0 - 99.9 \text{ m}\Omega$ $100 - 1000 \ m\Omega$ $1 \,\mathrm{m}\Omega$

Inaccuracy

 $0 - 1999 \mu\Omega$ ±1 % of reading ±1 digit $2-500~m\Omega$ ±2 % of reading ±1 digit $500 - 1000 \ m\Omega$ ±4 % of reading ±1 digit

Outputs + / -

Range $> 100 \text{ A DC (R} < 2 \text{ m}\Omega)$

Output voltage (max) 2.5 V DC

Generation duration Selectable: 0.1 s, 0.6 s, 3 s

	Recovery time at I min set to 100 A and load 100 $\mu\Omega$		
Generation time	Max	Тур	
0.1 s	10 s	8 s	
0.6 s	20 s	16 s	
3 s	130 s	100 s	

Inputs

SENSE + / -

Connector 4 mm banana jack

Voltage ±3 V DC

Threshold 8 V DC **Trigger input** 12 – 24 V DC, 2 A max DC IN

Logger

Label. Timestamp, I max, I min, I Limit, Logger, Data

Resistance, Meas.time, P/F limit

Labeling schemes Circuit breaker oriented or running

numbers

Capacity 104 measurements

Wireless communication

PC communication Bluetooth

INCLUDED ACCESSORIES



Test cables with Kelvin probes (incl. in BD-59090)



Test cables with Kelvin clamps (incl. in BD-59092)

OPTIONAL ACCESSORIES



Cable kit 5 m (16 ft), (GA-00380)



Calibration kit



Soft carrying case, (GD-00620)

ORDERING INFORMATIO	N
Item	Art. No.
MOM2	
Incl. Test cables with Kelvin probes (GA-90000)	
Transport case, Charger, Rubber holster, Carrying strap, Belt clip, MOM2 Win*	BD-59090
MOM2	DD-39090
Incl. Test cables with Kelvin clamps (GA-90001)	
Transport case, Charger, Rubber holster, Carrying	
strap, Belt clip, MOM2 Win*	BD-59092
MOM2	
Incl. Test cable red with Kelvin clamp (GA-00373) Test cable black with Kelvin clamp (GA-00374)	
Transport case, Charger, Rubber holster, Carrying	
strap, Belt clip, MOM2 Win*	BD-59093
*) MOM2 Win can be downloaded from:	
" <u>www.megger.com</u> " and search for MOM2	
Optional accessories	
Test cables with Kelvin probes (current & sense) 2 x 1.3 m (4 ft) (one with trig button), 16 mm ²	GA 90000
Test cables with Kelvin clamps (current & sense)	GA-90000
1.3 m (4 ft) red, 3 m (10 ft) black, 16 mm ²	GA-90001
Test cable with Kelvin probe	
1.3 m (4 ft) red, 16 mm ² (with trig button)	GA-00370
Test cable with Kelvin probe	
1.3 m (4 ft) black, 16 mm ²	GA-00371
Test cable with Kelvin clamp	CA 00272
3 m (10 ft) black, 16 mm ²	GA-00372
Test cable with Kelvin clamp 1.3 m (4 ft) red, 16 mm ²	GA-00373
Test cable with Kelvin clamp	GA 00373
5 m (16 ft) black, 25 mm ²	GA-00374
Test cable with Kelvin clamp	
10 m (33 ft) black, 16 mm ²	
This length in combination with the cable area	CA 00276
16 mm² results in a reduction of maximum current. Cable kit 5 m	GA-00376
Current cable 0.5 m (1.6 ft), Connection plate and	
sense cables 5 m (16 ft), Ground cable	GA-00380
Cable kit 10 m	
Current cable 0.5 m (1.6 ft), Connection plate and	
sense cables 10 m (33 ft), Ground cable	GA-00382
Cable kit 15 m	
Current cable 0.5 m (1.6 ft), Connection plate and sense cables 15 m (49 ft), Ground cable	GA-00384
Calibration kit	
	BD-90002
Soft carrying case For MOM2, Charger and Cables	GD-00620
Tot Wow, Charger and Cables	GD 00020

Postal address

Megger Sweden AB Box 724 SE-182 17 Danderyd **SWEDEN**